


Number of contacts

## 78+2, 60+4, 42+6, 24+8, 6+10

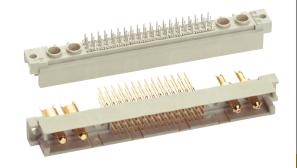

Male connectors

Identification	Drawing	Dimensions in mm
Order high current, high voltage, coaxial and fibre optic contacts separately, see pages 01.40 ff	94, 8 ± 0, 1 90 ± 0, 1 90 ± 0, 1 85, 3 ± 0, 1 11 8 5 2 - position  7, 62 (=22, 86)  2, 54  A  A  A  A  A  B  2: 1  8, 75 ± 0	a b 2.5 4.0 Ø 0.7 Solder pins 6.0 13 □ 0.6 Wrap posts 5.0 − 13 − Press-in pins 10.95 ±0.05 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9
Board drillings Mounting side	Solder Press-in  Board drillings depend on type and special contact loading	Y 1 ± 0.1 see recommendation page 00.25